

May 7, 2021

**Subject: RFQ #1956-A: Painting & Refurbishing the South Fayette WTP
Addendum #1**

Gentlemen/Ladies:

Below, please find responses to questions, clarification, or additional information for the above referenced Request for Quotes. You will need to consider this information when preparing your quote.

1. **In the balcony areas of the main building are the ceilings being painted or just washed?**
The ceilings are to be pressure washed and painted.
2. **Near the gate, is the contractor responsible for protecting the vegetation along the fence?**
Yes.
3. **Can the gate be left open while we paint it?**
Yes.
4. **Do we need to paint the gate mechanism arm which controls the gate?**
Yes, due to the corrosion already forming on the arms.
5. **Will the signage on the gate be removed before we paint?**
Yes.
6. **Is there a water connection near the gate?**
There is one on the front of the main building facing the fence.
7. **Do you want to reseal with clear sealant the stone on the bottom of the buildings?**
No.

8. Do you want the shutters replaced or painted?

We want them painted. There are a total of twelve shutters, two pair on the Filter Building and four pair on the Chemical Building. The shutters are solid core, polymer composite material with wrap-around marine grade aluminum stiles. Four screws fasten the shutter to the wall. The shutters are to be removed for painting, following the coating schedule. All quotes must include price to paint. Vendor may provide a cost adjustment to replace shutters in the Exceptions to Specifications if they choose to. Vendor shall submit data sheet for approval. Shutters manufactured by New Horizon Shutters, Inc. or approved equal. Stamped aluminum, molded vinyl, or wood shutters will not be accepted.

9. Do not use any solvents near any of the water.

10. On the specs for this project it states WTP Main Building is being pressure washed. It does not specify whether the entire building is getting washed or just the windows, doors, soffit and fascia are getting washed. Can you specify this?

Brick on the Filter building and the Chemical building are not to be pressure washed. However, all windows and louvers are to be washed and steel lintels inspected for paint failure. Paint lintels if needed and match exiting color. Clean the red clay off the bottom part of the buildings.

11. In the Scope of Work, it says caulk and seal. Where are we caulking and sealing at windows, doors, brick to brick control joints, and wood to wood, and wood to brick joints in the soffit?

Caulk to be applied to those areas being painted in the scope of work. Remove worn or damaged caulk and apply caulk at wood-to-wood and wood-to-brick surfaces, and around metal door frames, and other areas where needed. Caulk around windows and louvers is NOT included in the scope of work. Vendor will communicate to Water System staff caulk failure in those areas.

12. Is a permit required for this project?

No permit is required.

13. Will we be painting the overhead doors on the tractor barn?

Yes.

14. Please add the following to the Scope of Work addendum:

Recommended Caulk Specification: Sher-Max Urethanized Elastomeric Sealant, WL001355A, Sher-Max White

Surface Preparation: In addition to the surface preparation requirements outlined in the Scope of Work, the vendor will meet or exceed the guidelines in the document Basic Surface Preparation. (Attachment 1)

15. Can you confirm working hours Monday-Friday from 8:00AM-5:00PM for this project to be completed?

Contractors shall work Monday – Friday, 7:00 a.m. to 8:00 p.m.

16. Can the work be done on weekends, evenings, and/or nights?

No. Contractors shall work Monday – Friday, 7:00 a.m. to 8:00 p.m.

17. Can you confirm if bonding is/is not required for this project?

Bonding is not required for this project.

18. When is the anticipated start date?

The start date depends on the time it takes to complete the contract. Responders are asked on the pricing sheet to state the number of days needed to start work after a Notice to Proceed is issued. Fayette County would like work started as soon as possible.

18. Based on the current 'Statement of Work', are there any new (and/or additional) service requirements that are included in this proposed 'Statement of Work'?

All revisions to work are included in this addendum.

19. Based on the current 'Statement of Work' what are the total number of windows and doors that will require replacing caulking?

Caulk around windows and louvers is NOT included in the scope of work (see question 11). Drawings will be emailed to the mandatory pre-bid attendees.

21. Based on the current 'Statement of Work' will Fayette County Painting and Refurbishing the South Fayette Water Treatment Plant provide the dumpster, or will the Contractor be providing the dumpster? If the Contractor is providing a dumpster, will there be a secured area provided for the dumpster to be placed?

The Contractor will provide a dumpster and portable toilet. The plant property is secured with a perimeter fence.

22. Will additional consideration, based on the lowest priced evaluation, be reflected in the final price decision; based on the cost of doing business during and beyond the COVID-19 Pandemic?

No.

23. Based on the current 'Statement of Work' all painting shall be by brush and roller due to the high level of traffic is this correct?

Brush and roller are the preferred application methods. Please state other methods in the Exceptions to Specifications.

24. What is estimated time for completion for this project?

Per the pricing sheet, vendors shall state the maximum number of days needed to complete the project after the start of work.

25. Is there any presence of asbestos and/or mold?

No asbestos. No mold that we are aware of. Any issues shall be brought to the attention of the Plant Manager.

27. Can you provide us with a floor plan for this building?

Drawings will be emailed to the mandatory pre-bid attendees.

Received by (Name): _____ Company _____


Note: If this addendum is not returned to the Fayette County Purchasing Department or if it is returned not signed, responding individuals, companies or other organizations will still be responsible for the requirements of this addendum and the specifications or changes herein.

The opening date for this RFQ has not changed. **The opening time and date are 3:00 p.m., Monday, May 17, 2021.** Quotes must be received by the Purchasing Department at the address above, Suite 204, at or before the opening date and time.

The deadline for inquiries has passed, so the Purchasing Department will not be able to accept any additional questions after this time.

If you have questions, please contact Natasha Duggan, Contract Administrator at (770) 305-5150, fax (770) 719-5534 or email at nduggan@fayettecountyga.gov.

Sincerely,

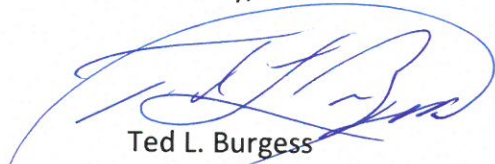

Ted L. Burgess
Director of Purchasing

Basic Surface Preparation

Coating performance is directly affected by surface preparation. Coating integrity and service life will be reduced because of improperly prepared surfaces. As high as 80% of all coating failures can be directly attributed to inadequate surface preparation that affects coating adhesion. Proper product selection, surface preparation, and application affect coating performance. Coating integrity and service life will be reduced because of improperly prepared surfaces. Selection and implementation of proper surface preparation ensures coating adhesion to the substrate and prolongs the service life of the coating system.

The majority of paintable surfaces are concrete, ferrous metal, galvanizing, wood and aluminum. They all require protection to keep them from deteriorating in aggressive environments. Selection of the proper method for surface preparation depends on the substrate, the environment, the coating selected, and the expected service life of the coating system. Economics, surface contamination, and the effect on the substrate will also influence the selection of surface preparation methods. Recognize that any surface preparation short of total removal of the old coating may compromise the service length of the system.

Verify the existence of lead based paints on the project. Buildings constructed after 1978 are less likely to contain lead based paints. If lead based paints are suspected on the project, all removal must be done in accordance with the EPA Renovation, Repair and Painting and all applicable state and local regulations. State and local regulations may be more strict than those set under the federal regulations. Verify that Owner has completed a Hazardous Material Assessment Report for the project prior to issuing of Drawings. Concluding that no lead based paints were found on project site, delete paragraph regarding lead based paints.

WARNING! Removal of old paint by sanding, scraping or other means may generate dust or fumes that contain lead. Exposure to lead dust or fumes may cause brain damage or other adverse health effects, especially in children or pregnant women. Controlling exposure to lead or other hazardous substances requires the use of proper protective equipment, such as a properly fitted respirator (NIOSH approved) and proper containment and cleanup. For more information, call the National Lead Information Center at 1-800-424-LEAD (in US) or contact your local health authority. Removal must be done in accordance with EPA Renovation, Repair and Painting Rule and all related state and local regulations. Care should be taken to follow all state and local regulations which may be more strict than those set under the federal RRP Rule.

No exterior painting should be done immediately after a rain, during foggy weather, when rain is predicted, or when the temperature is below 50°F, unless the products to be used are designed to be used in those environments.

Aluminum – S-W 1: Remove all oil, grease, dirt, oxide and other foreign material by cleaning per SSPC-SP1, Solvent Cleaning.

Block (Cinder and Concrete) – S-W 3: Remove all loose mortar and foreign material. Surface must be free of laitance, concrete dust, dirt, form release agents, moisture curing membranes, loose cement, and hardeners. Concrete and mortar must be cured at least 28 days at 75°F. The pH of the surface should be between 6 and 9. On tilt-up and poured-in-place concrete, commercial detergents and abrasive blasting may be necessary to prepare the surface. Fill bug holes, air pockets, and other voids with a cement patching compound (per ASTM D4261).

Brick – S-W 4: Must be free of dirt, loose and excess mortar, and foreign material. All brick should be allowed to weather for at least one year followed by wire brushing to remove efflorescence. Treat the bare brick with one coat of Loxon Conditioner.

Concrete and Masonry – Concrete, Poured – Exterior or Interior – S-W 5: The preparation of new concrete surfaces is as important as the surface preparation of steel. The following precautions will help assure maximum performance of the coating system and satisfactory coating adhesion:

- 1. Cure** – Concrete must be cured prior to coating. Cured is generally defined as concrete poured and aged at a material temperature of at least 75°F for at least 28 days unless specified products are designed for earlier application.
- 2. Moisture** – Reference ASTM F1869-98 Moisture Test by use of Calcium Chloride or ASTM D4263 Plastic Sheet Method. Concrete must be free from moisture as much as possible (it seldom falls below 15%). Vapor pressures, temperature, humidity, differentials, and hydrostatic pressures can cause coatings to prematurely fail. The source of moisture, if present, must be located, and the cause corrected prior to coating.
- 3. Temperature** – Air, surface and material temperatures must be in keeping with requirements for the selected product during and after coating application, until coating is cured.

4. Contamination – Remove all grease, dirt, paint, oil, laitance, efflorescence, loose mortar, and cement by the recommendations listed in the surface preparation section.

5. Surface Condition – Hollow areas, bug holes, voids, honeycombs, fin form marks, and all protrusions or rough edges are to be ground or stoned to provide a continuous surface of suitable texture for proper adhesion of the coating. Imperfections may require filling, as specified, with a recommended Sherwin-Williams product.

6. Concrete Treatment – Hardeners, sealers, form release agents, curing compounds, and other concrete treatments should be removed to ensure adequate coating adhesion and performance.

Methods of Surface Preparation on Concrete per SSPC-SP13/NACE 6 or ICRI 03732 Surface Cleaning Methods:
Vacuum cleaning, air blast cleaning, and water cleaning per ASTM D4258.

Used to remove dirt, loose material, and/or dust from concrete.

Detergent water cleaning and steam cleaning per ASTM D4258.

Used to remove oils and grease from concrete. Prior to abrasive cleaning, and after abrasive cleaning, surfaces should be cleaned by one of the methods described above.

Mechanical Surface Preparation Methods:

Dry abrasive blasting, wet abrasive blasting, vacuum assisted abrasive blasting, and centrifugal shot abrasive blasting per ASTM D4259. Used to remove contaminants, laitance, and weak concrete, to expose subsurface voids, and to produce a sound concrete surface with adequate profile and surface porosity.

High-pressure water cleaning or water jetting per SSPC-SP12-NACE5.

Used to remove contaminants, laitance, and weak concrete, to expose subsurface voids, and to produce a sound concrete surface with adequate profile and surface porosity.

Impact tool methods per ASTM D4259.

Used to remove existing coatings, laitance, and weak concrete. Methods include scarifying, planing, scabbling, and rotary peening. Impact tools may fracture concrete surfaces or cause microcracking requiring surface repair.

Power tool methods per ASTM D4259.

Used to remove existing coatings, laitance, weak concrete, and protrusions in concrete. Methods include circular grinding, sanding, and wire brushing. These methods may not produce the required surface profile to ensure adequate adhesion of subsequent coatings.

Chemical Surface Preparation Methods:

Acid etching per ASTM D4260. Use to remove some surface contaminants, laitance, and weak concrete, and to provide a surface profile on horizontal concrete surfaces. This method requires complete removal of all reaction products and pH testing to ensure neutralization of the acid. Not recommended for vertical surfaces. Etching with hydrochloric acid shall not be used where corrosion of metal in the concrete is likely to occur. Adequate ventilation and safety equipment required.

1. Clean surface per ASTM D4268
2. Wet surface with clean water
3. Etch with 10-15% muriatic acid solution at the rate of 1 gallon per 75 square feet
4. Scrub with stiff brush
5. Allow sufficient time for scrubbing and until bubbling stops
6. If no bubbling occurs, surface is contaminated. Refer to ASTM D4258 or ASTM D4259
7. Rinse surface two or three times. Remove acid/water each time.
8. Surface should have a texture similar to medium grit sandpaper.
9. Neutralize surface with a 3% solution of tri-sodium phosphate and flush with clean water.
10. Allow to dry and check for excess moisture.

Cement Composition Siding/Panels – S-W 6: Remove all surface contamination by washing with an appropriate cleaner, rinse thoroughly and allow to dry. Existing peeled or checked paint should be scraped and sanded to a sound surface. Glossy surfaces should be sanded dull. Pressure clean, if needed, with a minimum of 2100 psi pressure to remove all dirt, dust, grease, oil, loose particles, laitance, foreign material, and peeling or defective coatings. Allow the surface to dry thoroughly. If the surface is new, test it for pH, many times the pH may be 10 or higher.

Composition Board (Hardboard) – S-W 9: Some composition boards may exude a waxy material that must be removed with a solvent prior to coating. Whether factory primed or unprimed, exterior composition board siding (hardboard) must be cleaned thoroughly and primed with an alkyd primer.

Copper – S-W 7: Remove all oil, grease, dirt, oxide and other foreign material by cleaning per SSPC-SP2, Hand Tool Cleaning.

Drywall—Interior and Exterior – S-W 8: Must be clean and dry. All nail heads must be set and spackled. Joints must be taped and covered with a joint compound. Spackled nail heads and tape joints must be sanded smooth and all dust removed prior to painting. Exterior surfaces must be spackled with exterior grade compounds.

Galvanized Metal – S-W 10: Allow to weather a minimum of 6 months prior to coating. Clean per SSPC-SP1 using detergent and water or a degreasing cleaner, then prime as required. When weathering is not possible or the surface has been treated with chromates or silicates, first Solvent Clean per SSPC-SP1 and apply a test area, priming as required. Allow the coating to dry at least one week before testing. If adhesion is poor, Brush Blast per SSPC-SP16 is necessary to remove these treatments.

Plaster – S-W 11: Must be allowed to dry thoroughly for at least 30 days before painting. Room must be ventilated while drying; in cold, damp weather, rooms must be heated. Damaged areas must be repaired with an appropriate patching material. Bare plaster must be cured and hard. Textured, soft, porous, or powdery plaster should be treated with a solution of 1 pint household vinegar to 1 gallon of water. Repeat until the surface is hard, rinse with clear water and allow to dry.

Steel/Ferrous Metal Substrates

SSPC-SP1- Solvent Cleaning: Solvent cleaning is a method for removing all visible oil, grease, soil, drawing and cutting compounds, and other soluble contaminants. Solvent cleaning does not remove rust or mill scale. Change rags and cleaning solution frequently so that deposits of oil and grease are not spread over additional areas in the cleaning process. Be sure to allow adequate ventilation. Follow manufacturer's safety recommendations when using solvents. For complete instructions, refer to Steel Structures Paint Council Surface Preparation Specification No.1. (Refer to each products cleaning instructions. Many acrylic coatings will state; When cleaning the surface per SSPC-SP1, use only an emulsifying industrial detergent, followed by a water rinse. **Do not use hydrocarbon solvents for cleaning.**)

SSPC-SP2 - Hand Tool Cleaning: Hand Tool Cleaning removes all loose mill scale, loose rust, and other detrimental foreign matter. It is not intended that adherent mill scale, rust, and paint be removed by this process. Mill scale, rust, and paint are considered adherent if they cannot be removed by lifting with a dull putty knife. Before hand tool cleaning, remove visible oil, grease, soluble welding residues, and salts by the methods outlined in SSPC-SP1. For complete instructions, refer to Steel Structures Paint Council Surface Preparation Specification No.2.

SSPC-SP3 - Power Tool Cleaning: Power Tool Cleaning removes all loose mill scale, loose rust, and other detrimental foreign matter. It is not intended that adherent mill scale, rust, and paint be removed by this process. Mill scale, rust, and paint are considered adherent if they cannot be removed by lifting with a dull putty knife. Before power tool cleaning, remove visible oil, grease, soluble welding residues, and salts by the methods outlined in SSPC-SP1. For complete instructions, refer to Steel Structures Paint Council Surface Preparation Specification No.3.

SSPC-SP5 / NACE 1 - White Metal Blast Cleaning: A White Metal Blast Cleaned surface, when viewed without magnification, shall be free of all visible oil, grease, dirt, dust, mill scale, rust, paint, oxides, corrosion products, and other foreign matter. Before blast cleaning, visible deposits of oil or grease shall be removed by any of the methods specified in SSPC-SP 1 or other agreed upon methods. For complete instructions, refer to Joint Surface Preparation Standard SSPC-SP5/ NACE No.1.

SSPC-SP6 / NACE 3 - Commercial Blast Cleaning: A Commercial Blast Cleaned surface, when viewed without magnification, shall be free of all visible oil, grease, dirt, dust, mill scale, rust, paint, oxides, corrosion products, and other foreign matter, except for staining. Staining shall be limited to no more than 33 percent of each square inch of surface area and may consist of light shadows, slight streaks, or minor discoloration caused by stains of rust, stains of mill scale, or stains of previously applied paint. Before blast cleaning, visible deposits of oil or grease shall be removed by any of the methods specified in SSPC-SP 1 or other agreed upon methods. For complete instructions, refer to Joint Surface Preparation Standard SSPC-SP6/NACE No.3.

SSPC-SP7 / NACE 4 - Brush-Off Blast Cleaning: A Brush-Off Blast Cleaned surface, when viewed without magnification, shall be free of all visible oil, grease, dirt, dust, loose mill scale, loose rust, and loose paint. Tightly adherent mill scale, rust, and paint may remain on the surface. Mill scale, rust, and coating are considered adherent if they cannot be removed by lifting with a dull putty knife. Before blast cleaning, visible deposits of oil or grease shall be removed by any of the methods specified in SSPC-SP 1 or other agreed upon methods. For complete instructions, refer to Joint Surface Preparation Standard SSPC-SP7/NACE No.4.

SSPC-SP10 / NACE 2 - Near-White Blast Cleaning: A Near White Blast Cleaned surface, when viewed without magnification, shall be free of all visible oil, grease, dirt, dust, mill scale, rust, paint, oxides, corrosion products, and other foreign matter, except for staining. Staining shall be limited to no more than 5 percent of each square inch of surface area and may consist of light shadows, slight streaks, or minor discoloration caused by stains of rust, stains of mill scale, or stains of previously applied paint. Before blast cleaning, visible deposits of oil or grease shall be removed by any of the methods specified in SSPC-SP 1 or other agreed upon methods. For complete instructions, refer to Joint Surface Preparation Standard SSPCSP10/ NACE No.2.

SSPC-SP11 - Power Tool Cleaning to Bare Metal: Metallic surfaces that are prepared according to this specification, when viewed without magnification, shall be free of all visible oil, grease, dirt, dust, mill scale, rust, paint, oxide corrosion products, and other foreign matter. Slight residues of rust and paint may be left in the lower portions of pits if the original surface is pitted. Prior to power tool surface preparation, remove visible deposits of oil or grease by any of the methods specified in SSPC-SP 1, Solvent Cleaning, or other agreed upon methods. For complete instructions, refer to Steel Structures Paint Council Surface Preparation Specification No.11.

SSPC-SP12 / NACE 5 - Surface Preparation and Cleaning of Metals by Waterjetting Prior to Recoating: High- and Ultra-High Pressure Water Jetting for Steel and Other Hard Materials This standard provides requirements for the use of high- and ultra-high pressure water jetting to achieve various degrees of surface cleanliness. This standard is limited in scope to the use of water only, without the addition of solid particles in the stream. For complete instructions, refer to Joint Surface Preparation Standard SSPC-SP12/NACE No.5.

SSPC-SP13 / NACE 6 or ICRI 03732 - Surface Preparation of Concrete: This standard gives requirements for surface preparation of concrete by mechanical, chemical, or thermal methods prior to the application of bonded protective coating or lining systems. The requirements of this standard are applicable to all types of cementitious surfaces including cast-in-place concrete floors and walls, precast slabs, masonry walls and shotcrete surfaces. An acceptable prepared concrete surface should be free of contaminants, laitance, loosely adhering concrete, and dust, and should provide a dry, sound, uniform substrate suitable for the application of protective coating or lining systems. Depending upon the desired finish and system, a block filler may be required. For complete instructions, refer to Joint Surface Preparation Standard SSPC-SP13/NACE No.6 or ICRI 03732

SSPC-SP14 / NACE 8 – Industrial Blast Cleaning: This standard gives requirements for industrial blast cleaning of unpainted or painted steel surfaces by the use of abrasives. This joint standard allows defined quantities of mill scale and/or old coating to remain on the surface. An industrial blast cleaned surface, when viewed without magnification, shall be free of all visible oil, grease, dust, and dirt. Traces of tightly adherent mill scale, rust, and coating residue are permitted to remain on 10% of each unit area of the surface. The traces of mill scale, rust, and coating shall be considered tightly adherent if they cannot be lifted with a dull putty knife. Shadows, streaks, and discolorations caused by stains of rust, stains of mill scale, and stains of previously applied coating may be present on the remainder of the surface.

SSPC-SP16 Brush-Off Blast Cleaning of Coated and Uncoated Galvanized Steel, Stainless Steels, and Non-Ferrous Metals: This standard covers the requirements for brush-off blast cleaning of uncoated or coated metal surfaces other than carbon steel by the use of abrasives. These requirements include visual verification of the end condition of the surface and materials and procedures necessary to achieve and verify the end condition. A brush-off blast cleaned non-ferrous metal surface, when viewed without magnification, shall be free of all visible oil, grease, dirt, dust, metal oxides (corrosion products), and other foreign matter. Intact, tightly adherent coating is permitted to remain. A coating is considered tightly adherent if it cannot be removed by lifting with a dull putty knife.

High- and Ultra-High Pressure Water Jetting for Steel and Other Hard Materials:

SSPC-SP WJ-1/NACE WJ-1: Clean to Bare Substrate (WJ-1) is intended to be similar to the degree of surface cleanliness of SSPC-SP 5/NACE 1, except that stains are permitted to remain on the surface. This standard is used when the objective is to remove every trace of rust and other corrosion products, coating and mill scale.

SSPC-SP WJ-2/NACE WJ-2: Very Thorough Cleaning (WJ-2) is intended to be similar to the degree of surface cleanliness of SSPC-SP 10/NACE 2, except that tightly adherent material, rather than only stains, is permitted to remain on the surface. This standard is used when the objective is to remove almost all rust and other corrosion products, coating, and mill scale.

SSPC-SP WJ-3/NACE WJ-3: Thorough Cleaning (WJ-3) is intended to be similar to the degree of surface cleanliness of SSPC-SP 10/NACE 2, except that tightly adherent material, rather than only stains, is permitted to remain on the surface. This standard is used when the objective is to remove much of the rust and other corrosion products, coating, and mill scale, leaving tightly adherent thin films.

SSPC-SP WJ-4/NACE WJ-4: Light Cleaning (WJ-4) is intended to be similar to the degree of surface cleanliness of SSPC-SP 10/NACE 2, except that tightly adherent material, rather than only stains, is permitted to remain on the surface. This standard is used when the objective is to allow as much of the tightly adherent rust and other corrosion products, coating, and mill scale to remain as possible. Discoloration of the surface may be present.

Water Blasting NACE Standard RP-01-72: Removal of oil grease dirt, loose rust, loose mill scale, and loose paint by water at pressures of 2,000 to 2,500 psi at a flow of 4 to 14 gallons per minute.

Stucco S-W 22 : Must be clean and free of any loose stucco. If recommended procedures for applying stucco are followed, and normal drying conditions prevail, the surface may be painted in 30 days. The pH of the surface should be between 6 and 9.

Wood—Exterior – S-W 23: Must be clean and dry. Prime and paint as soon as possible. Knots and pitch streaks must be scraped, sanded, and spot primed before a full priming coat is applied. Patch all nail holes and imperfections with a wood filler or putty and sand smooth. Caulk should be applied after priming.

Wood—Interior – S-W 24: All finishing lumber and flooring must be stored in dry, warm rooms to prevent absorption of moisture, shrinkage, and roughening of the wood. All surfaces must be sanded smooth, with the grain, never across it. Surface blemishes must be corrected and the area cleaned of dust before coating.

Vinyl Siding, Architectural Plastics, PVC & Fiberglass: – S-W 24: Clean the surface thoroughly by scrubbing with warm, soapy water. Rinse thoroughly, prime with appropriate white primer. Do not paint vinyl with any color darker than the original color. Do not paint vinyl with a color having a Light Reflective Value (LRV) of less than 56 unless VinylSafe® Colors are used. If VinylSafe® Colors are not used and darker colors lower than an LRV of 56 are, the vinyl may warp. Follow all painting guidelines of the vinyl manufacturer when painting. Only paint properly installed vinyl siding. Deviating from the manufacturer's painting guidelines may cause the warranty to be voided.

Previously Coated Surfaces – S-W 12: Maintenance painting will frequently not permit or require complete removal of all old coatings prior to repainting. However, all surface contamination such as oil, grease, loose paint, mill scale dirt, foreign matter, rust, mold, mildew, mortar, efflorescence, and sealers must be removed to assure sound bonding to the tightly adhering old paint. Glossy surfaces of old paint films must be clean and dull before repainting. Thorough washing with an abrasive cleanser will clean and dull in one operation, or, wash thoroughly and dull by sanding. Spot prime any bare areas with an appropriate primer. Recognize that any surface preparation short of total removal of the old coating may compromise the service length of the system. Check for compatibility by applying a test patch of the recommended coating system, covering at least 2 to 3 square feet. Allow to dry one week before testing adhesion per ASTM D3359. If the coating system is incompatible, complete removal is required per ASTM D4259.

Touch-Up, Maintenance and Repair

For a protective coating system to provide maximum long-term protection, regularly scheduled maintenance is required. Maintenance includes inspection of painted areas, cleaning of surfaces to remove oils, chemicals, and other contaminants, and touch-up of areas where the coatings have been damaged. Highly corrosive areas, such as those subjected to frequent chemical spillage, corrosive fumes, and/or high abrasion or temperature areas should be inspected frequently – every six months, for example. Areas exposed to less severe conditions, such as interiors and exteriors of potable water tanks, may be inspected annually to assess the condition of the coating system.

The SSPC-VIS 2, Standard Method for Evaluating Degree of Rusting on Painted Steel Surfaces, can be used as a guide to determine appropriate touch-up and repairs maintenance schedules. Touch-up would be suggested when the surface resembles Rust Grade 5-S (Spot Rusting), 6-G (General Rusting), or 6-P (Pinpoint Rusting). Surface preparation would generally consist of SSPC-SP2, SP3, SP11, or SP12. Overcoating a well protected, but aged steel surface showing no evidence of rusting, may be achieved by Low Pressure Water Cleaning per SSPC-SP12/WJ4, and applying an appropriate coating system.

Full removal of the existing coating system by abrasive blasting would be recommended when the surface resembles Rust Grade 3-S (Spot Rusting), 4-G (General Rusting), or 4-P (Pinpoint Rusting). When the coating system has deteriorated to encompass approximately 33% of the surface area, it is always more economical to consider full removal and reapplication of the appropriate protective coating system.

Mildew –Prior to attempting to remove mildew, it is always recommended to test any cleaner on a small, inconspicuous area prior to use. Bleach and bleaching type cleaners may damage or discolor existing paint films. Bleach alternative cleaning solutions may be advised.

Mildew may be removed before painting by washing with a solution of 1 part liquid bleach and 3 parts water. Apply the solution and scrub the mildewed area. Allow the solution to remain on the surface for 10 minutes. Rinse thoroughly with water and allow the surface to dry before painting. Wear protective eyewear, waterproof gloves, and protective clothing. Quickly wash off any of the mixture that comes in contact with your skin. Do not add detergents or ammonia to the bleach/water solution.